



UPDATED\_COMPOSITES.GPJ 2/16/22

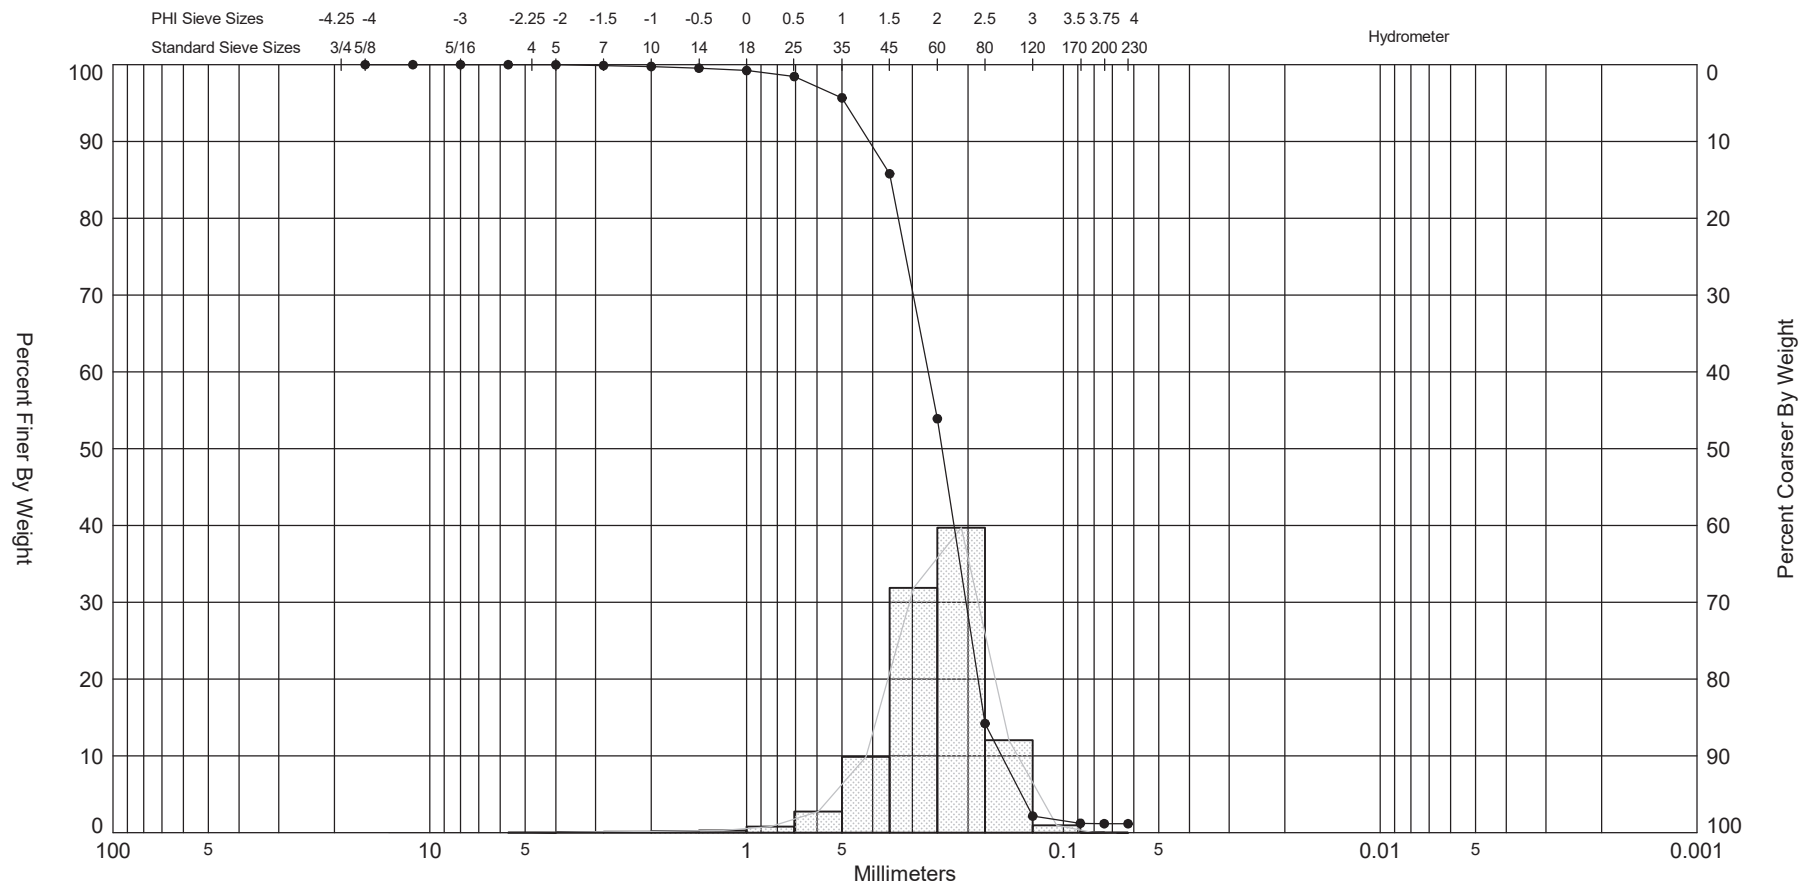

Gravel		Sand			Silt and Clay
Coarse	Fine	Coarse	Medium	Fine	

Sample	Symbol	Elev. (ft)	USCS	% Fines	% Organics	% Carbonates	Median	Mean	Skew	Kurt	Sort	Sample Information	
DIVC-22-04 COMP.	—●—	0.0	SP	#200 - 1.17 #230 - 1.16			2.05	1.98	-1.31	8.18	0.56	Project Name:	Dauphin Island Shore Protection
Comments:												Analysis Date:	02-09-22
Depths and elevations based on measured values												Analyzed By:	BF
						APTIM 6401 Congress Avenue, Suite 140 Boca Raton, FL 33487 ph (561) 391-8102						Easting (X, ft):	
												Northing (Y, ft):	
												Horizontal Datum:	NAD 1983
												Vertical Datum:	NAVD 88